

Update firmware from web interface:

1. Login into the IP Camera via IE.
2. Click on Configure->System->Firmware Update
3. Click on "Browse" button to locate the firmware file, flasham.bin.
4. Click on "OK" button.
5. Wait the web interface to be reloaded again.

Note: Firmware 2.6.74 can NOT be upgraded to firmware 2.7.90. If you wish to upgrade from firmware 2.6.74 to 2.7.90, please send back the camera to LILIN for firmware upgrade.

WARNING!

YOU DO NOT HAVE TO UPDATE YOUR DEVICE TO THE LATEST FIRMWARE. HOWEVER, THE LATEST FIRMWARE MAY IMPROVE A DEVICE'S PERFORMANCE AND ADD ADDITIONAL FEATURES. THERE IS A RISK OF FAILURE WHEN UPDATING A FIRMWARE, THIS INCLUDES POWER FAILURE, LOW BANDWIDTH OR BROKEN FLASH DISK. A FAILED FIRMWARE UPDATE WILL REQUIRE RETURNING THE DEVICE BACK TO YOUR ORIGINAL PROVIDER FOR REPAIR.

Version 2.7.92.8848

1. Fixed the MQTT authenticating function.
2. Modified the way of display for HTTP POST.
3. Upgraded the ActiveX to 1.0.50.172 version.

Version 2.7.92.8113a

1. Fixed the camera model number and MAC address have a chance to go back to the factory default.

Version 2.7.92.8113

1. Fixed the image will not be received issue when the streaming method in Milestone is set to RTP/RTSP/HTTP/TCP.
2. Fixed SG1122, switching from normal mode to HDR mode will cause vertical flip to turn off.
3. Fixed SG1122, when 50Hz is switched to 60Hz, IE displays 50Hz but the ODM still display as 50Hz.
4. Added 720*400 resolution.
5. Fixed link connection error after LOG search.
6. Fixed User Management could not add a 10th account when using ODM.
7. Fixed cgi command /trigger?sendftp=1 transfer image file to ftp no response.
8. Fixed http post url cannot save '&' character.
9. Fixed JPEG switch to H264, first time save bitrate is index error.
10. Fixed image display became abnormal when DHD set up contrasts and brightness.

Version 2.7.92.7356

1. The symbol detection cannot draw the line and the symbol frame will reduce to the upper left corner, unable to save.
2. When the object counting function is turned on, and in General page, streaming, resolution or number of frames and etc was modified, the number of counts will be cleared, it is recommended to have a warning, and the system log does not have any record.
3. When Log in with IPV6, Log's IP and computer's IP display method are different
4. SYSTEM LOG SD Card Recording date error.
5. Fixed http will crash issue caused by too many IVS objects when the screen is complicated.
6. Fixed Audio Detection no action issue.
7. Fixed P2P login with new account or change password cannot be used.
8. UPNP default is off.
9. Added IVS version upgrade field.
10. Fixed the audio data is abnormal when render AVI file from SD card.

Version 2.7.92 (svn6356)

1. Network default is DHCP, IP default is 192.168.1.200
2. Added support 2560x1440(3.6MP) and 1280x720(720P) resolution
3. Default is provide 4 sets of video streams simultaneously
4. File Recovery
5. Improved push service
6. Improved General page display
7. Improved SetVideoEncoderConfiguration message.
8. Support Milestone XProtect Professional 2017 R2, Version: 11.2a
9. Support RS-485 read, write function
10. Support ONVIF Profile S certification.
11. Fixed when power on, will read MAC file aside from LILIN version.
12. Fixed NAV focus speed range to work as per new architecture °
13. Fixed NAV version 2.0.0.108 cannot control zoom in & zoom out
14. Fixed NAV zoom speed range to work as per new architecture °
15. Fixed bug: the default value is incorrect after updating model type
16. Fixed SYS_LOG_INFO PAGE UI color
17. Fixed GetVideoSources reply to daytime brightness error
18. Fixed ONVIF tool 17.12 TEARDOWN issue
19. Fixed when user change administrator account password, logged-in in Onvif will delete user's account resulting to unable to log in to device.
20. Modify the timezone setting to write the corresponding Nvram
21. Fixed when device name exceeds 40 characters, turn on the ODM will cause the camera to crash re-start.

Version 2.7.90 (2017/11/23)

1. Supported new stream method for S series.(new function)
- 2 Supported IVS 2.0 and IVS 2.1 for S series. (new function)
- 3 Supported TLS for SMTP function.
- 4 Supported SIP function.
- 5 Supported HTML5 video stream in the chrome, FireFox and safari browser.
- 6 Support search event log and improve event log.
- 7 Support MQTT function.
- 8 Support HTTPS for LILIN DDNS Server.
- 9 Add Push Service page for mobile phone.

Version 2.6.74 (2017/03/16)

1. Added support for new camera ZSR8122
2. Added focus and zoom speed for auto focus page.
3. Fixed HDR mode
4. Added Quick Zoom Wide feature for wider FOV

For technical support information, please contact:

LILIN ZenDesk at https://lilin.zendesk.com/anonymous_requests/new.

For sales information, please contact:

Michelle, International Sales Director, at
Email: mma@meritlilin.com.tw.

Merit LILIN Enterprise Co., LTD.
No.20, Wu-Gong 6th Rd., New Taipei Industrial Park, Wu-Gu Dist.,
New Taipei City 248, Taiwan (R.O.C.)
TEL: 886-2-2298-8988 FAX: 886-2-2298-9077
www.meritlilin.com